

**City of Wichita, Kansas  
Americans with Disabilities Act Transition Plan**

**Herman Hill Park**

101 East Pawnee

**July 2005**



Prepared by

**DMCG**  
**Disability Management Consulting Group L.L.C.**  
2801 Jonquil Place  
Columbia, MO 65202

In conjunction with

**The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board**

---

City of Wichita – ADA/504 Transition Plan – Herman Hill Park - July 2005 Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations		Structural Inconsistencies	Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
1. Play Equipment	An appropriate number of ground level play components do not exist.	<a href="#">15.6.4</a> <a href="#">1</a> <a href="#">(GADAAGFR)</a>	Since ADAAG does not specifically provide guidance on how to make play areas accessible, we are required to examine existing federal information, which is currently not part of the ADA and, therefore, not enforceable guidance. Two such documents exist; the <a href="#">Play Areas, Final Rule</a> , October, 18 <sup>th</sup> , 2000 (Play Areas Final Rule); and the <a href="#">New ADAAG</a> , November 24 <sup>th</sup> , 2004, Chapter 2, 240 Play Areas and Chapter 10, 1008 Play areas (New ADAAG). In essence, both of the Play Areas Final Rule and New ADAAG are identical and both were created by the U.S. Access Board. The composite play components within this play area are accessible according to the Play Areas – Final Rule. However, according to GADAAGFR, <a href="#">Table 15.6.2.2</a> , where 5 to 7 elevated play components exist, at least 2 different types of ground level play components must exist and be located on an accessible path. <b>Provide at least two accessible ground level play components located on an accessible path of travel.</b>	L	H	M	<a href="#">2</a>	\$3,000	For additional qualitative guidance we utilized “ <a href="#">Guide to the ADAAG &amp; Final Rule (GADAAGFR)</a> ” and “ <a href="#">Stabilized Engineered Wood Fiber for Accessible Playground Surfaces, Final Report (SEWFAPS)</a> : Phase III, December 2004. <i>(not enforceable)</i>	Expand the variety of ground level play equipment by providing two accessible ground level play components.	12/31/16	
2. Restrooms	The coat hooks in the men’s and women’s restrooms are located too high at 66-inches.	<a href="#">4.25.3</a>	Where coat racks or hooks are provided, at least one must comply with reach ranges defined by ADAAG <a href="#">4.2.5</a> or <a href="#">4.2.6</a> . <b>Install a lowered coat hook, in each restroom, making sure not to make the hook a protruding object.</b>	L	H	M	<a href="#">4</a>	\$20	<a href="#">Building Block 10 – Reach Ranges</a>	Lower the coat hooks to 48” from finished floor level.	12/31/16	



**Herman Hill Park - Conceptual Cost Projections**

<b>Total</b>	<b>\$3,220</b>
<b>Year One (Very High)</b>	<b>\$0</b>
<b>Year Three (High)</b>	<b>\$0</b>
<b>Year Five (Medium)</b>	<b>\$0</b>
<b>Year Ten (Low)</b>	<b>\$3,220</b>