

**City of Wichita, Kansas
Americans with Disabilities Act Transition Plan**

Glenn Village Park

3501 South Washington

August 2005



Prepared by

DMCG

Disability Management Consulting Group L.L.C.

2801 Jonquil Place
Columbia, MO 65202

In conjunction with

The Great Plains ADA & IT Center and the City of Wichita Disability Advisory Board

City of Wichita – ADA/504 Transition Plan – Glenn Village Park - August 2005

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed <i>(Include initial)</i>
1. Pedestrian Paths	The path of travel (sidewalk) leading to the play area has an abrupt change in level.	4.3.8 4.5.2	According to ADAAG, changes in level up to 1/4 in (6 mm) may be vertical and without edge treatment (see Fig. 7(c)). Changes in level between 1/4 in and 1/2 in (6 mm and 13 mm) shall be beveled with a slope no greater than 1:2 (see Fig. 7(d)). Changes in level beyond 1/2-inch shall be accomplished by means of ramp, lift or elevator. Modify a portion of the steps, with a ramp, which complies with ADAAG specifications.	M	H	M	1	\$300	ADAAG	Provide an ADAAG compliant ramp complete with truncated domes detectable warning surface to the play area.	12/31/11	

City of Wichita – ADA/504 Transition Plan – Glenn Village Park - August 2005

Legend: **Blue** font identifies hyperlinked documents – **Red** font indicates recommended changes to structures or policies

Locations	Structural Inconsistencies		Recommended Corrections/Modifications to Ensure Program Access	Criteria – L=low, M=medium, H=high			Supplemental Technical Information			Finalized Actions		
Location	Identified Issue	ADAAG Specifications	Recommended Correction	Priority (overall)	Public Access	Frequency - PWD	Photo #	Conceptual Costs	Support Information	Finalized Correction	Date to be Corrected	Date Completed (Include initial)
2. Play Equipment	A stable, firm and slip resistant surface does not exist leading to the individual play components and does not exist in the use zone around any of the play facilities.	15.6.4 1 (GAD AAG FR)	Since ADAAG does not specifically provide guidance on how to make play areas accessible, we are required to examine existing federal information, which is currently not part of the ADA and, therefore, not enforceable guidance. Two such documents exist; the Play Areas, Final Rule , October, 18 th , 2000 (Play Areas Final Rule); and the New ADAAG , November 24 th , 2004, Chapter 2, 240 Play Areas and Chapter 10, 1008 Play areas (New ADAAG). In essence, both of the Play Areas Final Rule and New ADAAG are identical and both were created by the U.S. Access Board. The individual and composite play components within this play area are accessible according to the Play Areas – Final Rule. However, Accessible routes do not lead to required accessible play equipment, due to surface cross slopes greater than 1:50, running slopes greater than 1:12, and abrupt changes in level greater than ½-inch. In other words, the existing sand surface is not considered an accessible surface. To ensure an accessible route surface, not requiring regular maintenance, which is also impact attenuating, we recommend that one accessible path of travel, be installed which consists of rubber tiles or poured rubber, leading to each single play component. We also recommend that a rubber surface be provided in the use zones of each single play component. However, such rubber surface is not technically required by the available accessibility guidance. (Note: A well maintained wood fiber surface, as defined in (SEWFAPS) , is also considered accessible under the conditions that such surface is maintained regularly.	L	H	M	2 3	\$3,000	For additional qualitative guidance we utilized “ Guide to the ADAAG & Final Rule (GADAAGFR) ” and “ Stabilized Engineered Wood Fiber for Accessible Playground Surfaces, Final Report (SEWFAPS) : Phase III, December 2004. <i>(not enforceable)</i>	Create an accessible route of travel to all play areas and provide a rubber surface in the use zones of each play area.	12/31/16	

Glenn Village Park - Conceptual Cost Projections

Total	\$3,300
Year Three (Low)	\$3,000
Year Five (Medium)	\$300
Year Ten (High)	\$0